

ORDER NO SO0068389	DATE 05/22/2024
PAYMENT TERMS Credit Card	

TITAN MACHINERY-SCOTTSBLUFF
PO BOX 1070
SCOTTSBLUFF NE 69363-1070

CUSTOMER NO BP0015631	PAGE NO 1
CUSTOMER PO	

**SERVICE INVOICE
(PROFORMA)**

INVOICE TO:

ZEILER, MIKE
110293 COUNTY RD 33
MINATARE NE 69356-1929

WORK SITE:

TITAN MACHINERY-SCOTTSBLUFF
PO BOX 1070
SCOTTSBLUFF NE 69363-1070

SALESMAN: GIECK, SETH
CONTACT :

SERVICE ORDER : SO0068389
REF:

CASE IH MODEL:3240 SPRAYS S/N: YFT042267 CUST UNIT: UNIT:E00021742
METER : 1003

SEGMENT : 1 Uptime Inspection UPTIME INSPECTION CHARGE

SEGMENT TYPE: Chargeable

CASE IH MODEL:3240 SPRAYS S/N:YFT042267 CUST UNIT: UNIT:E00021742

Worksite : TITAN MACHINERY-SCOTTSBLUFF PO BOX 1070 SCOTTSBLUFF NE 69363-1070

METER : 1003

CORRECTION:

Checklist machine

ITEM / Lot ID	DESCRIPTION	QTY	B/O	PRICE(USD)CORE	TOTAL
	UPTIME INSPECTION	0.00		0.00	
SEGMENT 1 TOTAL:	0.00 PARTS	0.00 Labor			0.00 TAX

SEGMENT : 2 Uptime Repair. UPTIME INSPECTIONS AG REPAIR

SEGMENT TYPE: Chargeable

CASE IH MODEL:3240 SPRAYS S/N:YFT042267 CUST UNIT: UNIT:E00021742

Worksite : TITAN MACHINERY-SCOTTSBLUFF PO BOX 1070 SCOTTSBLUFF NE 69363-1070

METER : 1030

WORK DESCRIPTION :

Uptime Repair.

CORRECTION:

Remove and replace all deaf filters.
Run dosing routine and check operation.
Update engine software for fault code in the background that the customer is unaware of.
Recheck for fault code after test run fault not present
Remove and replace fan belt and air conditioning belt.
Remove and weld alternator belt shield
Tighten various bolts on boom and back rack section
Remove and replace two poly covers on small tube of boom where it

ORDER NO SO0068389	DATE 05/22/2024
------------------------------	--------------------

TITAN MACHINERY-SCOTTSBLUFF
PO BOX 1070
SCOTTSBLUFF NE 69363-1070

CUSTOMER NO BP0015631	PAGE NO 2
--------------------------	--------------

PAYMENT TERMS Credit Card

**SERVICE INVOICE
(PROFORMA)**

CUSTOMER PO

cradles
Pressure up machine, but did not spray as it still had antifreeze in it
Verify correct operation of Guidance.
Run and test dry

ITEM / Lot ID	DESCRIPTION	QTY	B/O	PRICE(USD)	CORE	TOTAL
47364243	FILTER DEF	1	0		0.00	
84247272	STRAINER FILTER	1	0		0.00	
84367903	FILTER DEF	1	0		0.00	
87267338	WEATHERSTRIP	2	0		0.00	
87519458	V-BELT	1	0		0.00	
87518813	V-BELT	1	0		0.00	
87602663	CHANNEL	2	0		0.00	
	SHOP SUPPLIES	0.00				
	FREIGHT & HANDLING	0.00				

SEGMENT	2 TOTAL:					0.00 TAX
---------	----------	--	--	--	--	----------

SEGMENT : 3 belt mis made. WARRANTY AG
SEGMENT TYPE: Non-Chargeable
CASE IH MODEL:3240 SPRAYS S/N:YFT042267 CUST UNIT: UNIT:E00021742
Worksite : TITAN MACHINERY-SCOTTSBLUFF PO BOX 1070 SCOTTSBLUFF NE 69363-1070
METER : 1003

WORK DESCRIPTION :
High-pitched squealing sound at high RPM

CAUSE:
fan belt, found where it was missed made by an eighth of a rib

CORRECTION:
Test run machine after belt replacement.
Found fan belt was tracking forward one rib on fan pulley.
Checked and verified alignment of pulleys on engine
Remove engine, fan belt, found where it was missed made by an eighth of a rib.
Order Parts
Reinstall engine, fan belt and air conditioning belt
Test run machine outside of shop for an hour to verify correct

ITEM / Lot ID	DESCRIPTION	QTY	B/O	PRICE(USD)	CORE	TOTAL
87519458	V-BELT	1	0		0.00	

SEGMENT	3 TOTAL:			0.00 MISC.		0.00 TAX
---------	----------	--	--	------------	--	----------

ORDER NO SO0068389	DATE 05/22/2024
PAYMENT TERMS Credit Card	

TITAN MACHINERY-SCOTTSBLUFF
PO BOX 1070
SCOTTSBLUFF NE 69363-1070

CUSTOMER NO BP0015631	PAGE NO 3
CUSTOMER PO	

**SERVICE INVOICE
(PROFORMA)**

ITEM	/	DESCRIPTION	QTY	B/O	PRICE(USD)	CORE	TOTAL
Lot ID							

SALES TAX DETAILS:
VERTEX -VERTEX TAX

: 0.00

PARTS LABOR MISC.	
SALES TAX	
INVOICE TOTAL (USD)	

Note: